

Handling Instructions 38784A


SPINNER Dial Gauge

BN 53 70 86 for measuring the pin depth of the 1.0 mm socket according to IEC 61169-31

Range of application:

The dial gauge measures:

- Pin depth for grade 0 connectors (yellow range)
- Pin depth for grade 1 connectors (green range)

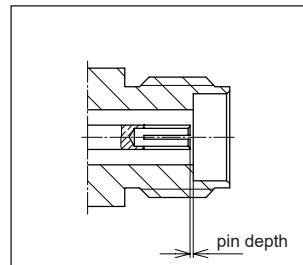

Handling:

- Clean the interface of dial gauge, reference gauge and connector
 - Check zero setting of pointer with the reference gauge
- The following procedure must be executed prior to the test of every inspection lot:

- Insert reference gauge and tighten with a torque wrench.
- Torque: $34 \pm 3 \text{ N}\cdot\text{cm}$ recommended
 $30 \text{ N}\cdot\text{cm}$ to $41 \text{ N}\cdot\text{cm}$ acc. to IEC 61169-31
 $45 \pm 5 \text{ N}\cdot\text{cm}$ acc. to IEEE Std 287
- Pointer = 0 : pointer adjustment is not necessary
- Pointer $\neq 0$: loosen protective cap, adjust pointer to zero position and tighten protective cap
- Remove reference gauge
- Insert connector and tighten with the same torque wrench as before.
- Check measured value of pin depth according to table.

Note:

The dial gauge and reference gauge are precision measurement devices.

Therefore handle with care and consider as following:

- The dial gauge and the connector interface must be neat and clean
- Hold the calibration device steady and turn the nut only
- Hold dial gauge and reference gauge at the knurled handle only
- Use only the reference gauge supplied.
- Always use a torque wrench to achieve best measurement accuracy and repeatability.

Torque: $34 \pm 3 \text{ N}\cdot\text{cm}$ recommended
 $30 \text{ N}\cdot\text{cm}$ to $41 \text{ N}\cdot\text{cm}$ acc. to IEC 61169-31
 $45 \pm 5 \text{ N}\cdot\text{cm}$ acc. to IEEE Std 287


- Measuring temperature: $23 \pm 5^\circ\text{C}$
- Protect against humidity
- Prevent soiling
- Avoid shocks
- Do not lubricate
- A calibration is recommended at regular intervals

The suggested initial interval for recalibration is 12 months. The actual need for recalibration depends on the use and the maintenance of the gauge.

The recalibration interval should begin with the day of initial use.

Measurement accuracy:

Pin depth is the distance between outer conductor mating plane and inner conductor mating plane. Starting from the zero position, measured values in counterclockwise direction mean that the inner conductor is recessed, measured values in clockwise direction mean that the inner conductor is protruding.

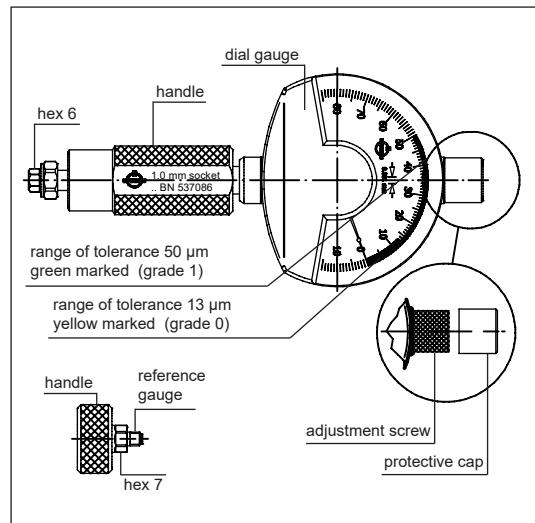

Type	Specified pin depth acc. to IEC61169-31	Measurement error, max.
Metrology grade	3 to 13 μm	3 μm
Instrument grade	3 to 50 μm	3 μm

The measurement error includes the measurement inaccuracy of the dial gauge.

Example:

A measured value of 6 μm means that the actual value is between 3 μm and 9 μm , taking into account the measurement error.


SPINNER Dial Gauge

BN 53 70 86 for measuring the pin depth of the 1.0 mm socket according to IEC 61169-31

Cleaning:





Dial gauge, reference gauge and connector interface, especially the outer conductor, should be kept clean and free of dirt and other debris.

- Dampen a lint-free swab with denatured alcohol
- Gently rotate the swab in the interface around the inner conductor being careful not to stress or bend the pin
- Ensure that no foreign material remains in the interface after cleaning
- Ensure that the inner conductor of the connector has not been bent or damaged

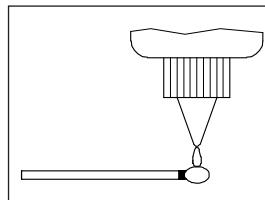

Note:

- Only dampen the swab. Do **NOT** saturate it.
- Do **NOT** use other cleaning fluids nor solvents than denatured alcohol. Do **NOT** use water.
- Never put lateral pressure on the connector's inner conductor.
- Do **NOT** put in the swab at an angle, otherwise you will damage the connector.
- Do **NOT** use too large swabs, otherwise you will damage the connector. Only use lint-free swabs which are designed for precision applications needing pinpoint accuracy (e.g. swabs with polyvinylidene fluoride tip).
- The inner conductor does not require cleaning.

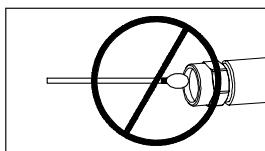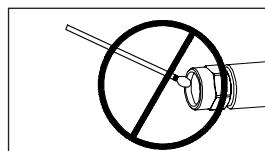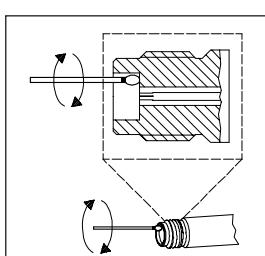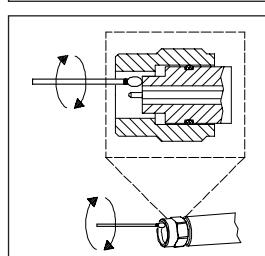

These instructions are written for qualified and experienced personnel. Please study them carefully before starting any work. Any liability or responsibility for the results of improper or unsafe installation practices is disclaimed. Please respect valid environmental regulations for assembly and waste disposal. Studieren Sie bitte sorgfältig vor Beginn der Montage diese Anleitung, die für geschultes und qualifiziertes Personal erstellt ist. Bei unsachgemäßem Montage ist eine Haftung bzw. Gewährleistung ausgeschlossen. Bitte beachten Sie bei Montage und Entsorgung die geltenden Umweltschutzbestimmungen. Ces instructions sont écrites pour des personnes qualifiées et expérimentées. Il est nécessaire de bien les lire avant de commencer l'installation. Notre responsabilité ne pourra être engagée si l'installation n'a pas été faite en conformité avec nos instructions. Prière de respecter les règles d'environnement en application pour le montage. Estas instrucciones están dirigidas a personal calificado y con la debida experiencia. Por favor leélas cuidadosamente antes de iniciar su trabajo. No asumimos ninguna responsabilidad derivada de instalaciones impropias ó sin las adecuadas medidas de seguridad. Por favor respete las regulaciones para protección ambiental y deseche de desperdicios. Estas instrucciones são dirigidas ao pessoal qualificado e com a devida experiência. Por favor leia-as atentamente antes de começar a tarefa. Não assumimos nenhuma responsabilidade devido a execução da instalação de maneira imprópria ou sem as adequadas medidas de segurança. Por favor respeite os regulamentos válidos de meio ambiente para a montagem e remoção de resíduos. 本安装说明为合格及有经验的操作人员所用。请在安装之前仔细阅读。任何不恰当或不安全的安装所引起的责任，都将不予受理，并请遵守关于装配件及废物弃置的有效环保条。